



Profile: Rectangle 30x50mm

Base: 0.348kg/m Cover: 0.390kg/m Total: 0.738kg/m

Batten thickness: 1.2mm End cap thickness: 3.0mm

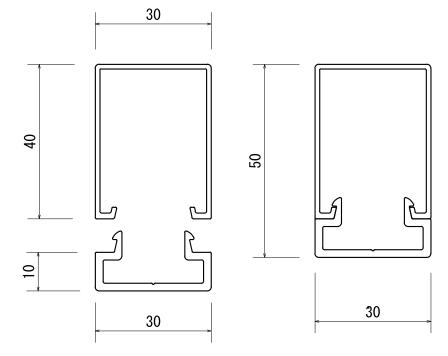

Endcap detail

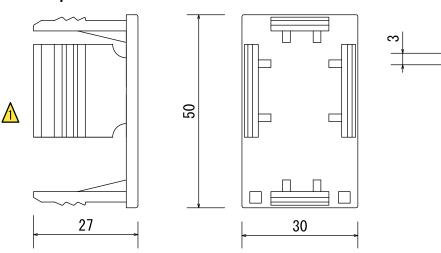








3				Product Name			Project Name	Creation Date	Page	Scale	Projection
<u> 23</u>		Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Eve	r Art Woo	d - Kabe	bari	Rectangle 30x50		1 of 12	1:1	♦ □
Λ	End caps	Secure to batten with screw or exterior grade adhesive (Sikaflex).	Approval	Chek	Drawing	Design	Customer	Distr	ibutor	Manu	facturer
No.	DATE		1					CO	veť	"T	ikasho

30

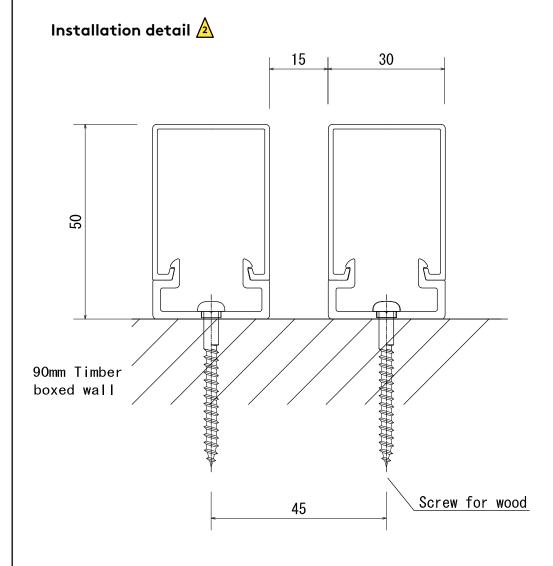


- Aluminium can be damaged if mishandled. Never strike directly with a hammer or rubber mallet. Use a pine plank between the striking rubber mallet and the extrusion to avoid surface damage or denting.
- Cut aluminium with a drop saw using an aluminium blade.
- Always cap ends of extrusions with supplied end caps or a flashing to avoid moisture ingress.
- Plastic end caps must be securely inserted with screws supplied or sikafelx applied to the inside of the extrusion before inserting. This will prevent slippage of the extrusion.
- Metal end caps (painted) must be screwed to the extrusion.
- All end caps can only be applied to straight 90 degree cuts. They cannot be applied to angle end cuts.
- Ensure appropriate screws are used to suit the substrate you are fastening to. It is important to use stainless steel or bi-metal screws for all metal surfaces impacted when fastening (i.e. furring channels, top hats, steel frames). This will prevent galvanic reaction between the screw/substrate and aluminium extrusion.
- Fasten at maximum 1 metre spans. Please contact Covet for further information.
- Always fasten the male (base) section first. The female (top section) clips over the top. They can also slide on if necessary.

A				Product Name			Project Name	Creation Date	Page	Scale	Projection
<u> </u>		Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Ever	r Art Woo	od - Kabel	bari	Rectangle 30x50		2 of 12	1:1	₩□
Λ	End caps	Secure to batten with screw or exterior grade adhesive (Sikaflex).	Approval	Approval Chek Drawing Design			Customer	Distributor		Manufacturer	
No.	DATE		1					CO	veť	- T	akasho

Profile: Rectangle 30x85mm


Base: 0.348**k**g/m Cover: 0.712kg/m Total: 1.060kg/m

Batten thickness: 1.2mm End cap thickness: 3.0mm

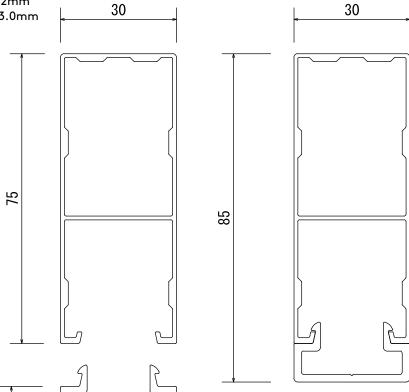


30

Endcap detail 🛕

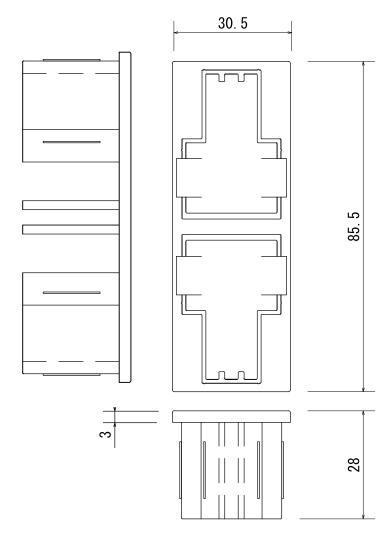

3				Produc	t Name		Project Name	Creation Date	Page	Scale	Projection
<u> </u>		Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Eve	r Art Woo	od - Kabel	bari	Rectangle 30x85		3 of 12	1:1	♦ □
Λ	End caps	Secure to batten with screw or exterior grade adhesive (Sikaflex).	Approval	Chek	Drawing	Design	Customer	Distr	ibutor	Manu	facturer
No.	DATE		1					CO	veť	" Te	ikasho

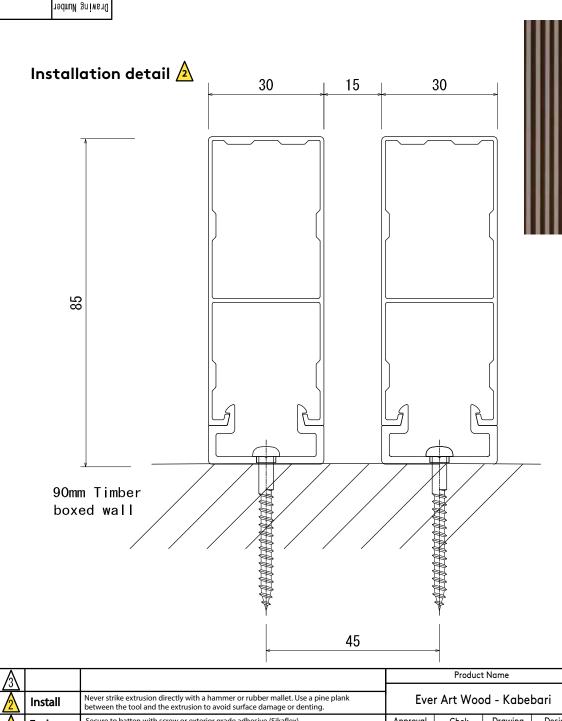






- Aluminium can be damaged if mishandled. Never strike directly with a hammer or rubber mallet. Use a pine plank between the striking rubber mallet and the extrusion to avoid surface damage or denting.
- Cut aluminium with a drop saw using an aluminium blade.
- Always cap ends of extrusions with supplied end caps or a flashing to avoid moisture ingress.
- Plastic end caps must be securely inserted with screws supplied or sikafelx applied to the inside of the extrusion before inserting. This will prevent slippage of the extrusion.
- Metal end caps (painted) must be screwed to the extrusion.
- All end caps can only be applied to straight 90 degree cuts. They cannot be applied to angle end cuts.
- Ensure appropriate screws are used to suit the substrate you are fastening to. It is important to use stainless steel or bi-metal screws for all metal surfaces impacted when fastening (i.e. furring channels, top hats, steel frames). This will prevent galvanic reaction between the screw/substrate and aluminium extrusion.
- Fasten at maximum 1 metre spans. Please contact Covet for further information.
- Always fasten the male (base) section first. The female (top section) clips over the top. They can also slide on if necessary.


$\sqrt{3}$				Produc	t Name		Project Name	Creation Date	Page	Scale	Projection
<u> 2</u>	Install	Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Ever	Ever Art Wood - Kabebari			Rectangle 30x85		4 of 12	1:1	₩
Λ	End caps	Secure to batten with screw or exterior grade adhesive (Sikaflex).	Approval	Chek	Drawing	Design	Customer	Distr	ibutor	Manu	facturer
No.	DATE		-					CO	veť	Ta Ta	ik as Ho

Profile: Rectangle 40x20mm

Base: 0.403kg/m Cover: 0.231kg/m Total: 0.634kg/m


Batten thickness: 1.0mm End cap thickness: 1.0mm

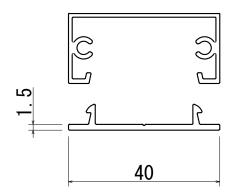






Endcap detail

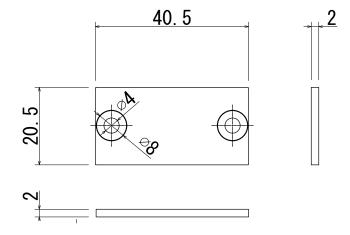

Installation detail 🛕

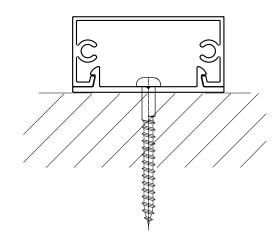


3				Product	t Name		Project Name	Creation Date	Page	Scale	Projection
<u> </u>	Install	Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Eve	r Art Woo	od - Kabe	bari	Rectangle 40x20		5 of 12	1:1	₩□
Λ	End caps	Screw fix or apply exterior grade adhesive (Sikaflex) to secure cap to batten.	Approval	Chek	Drawing	Design	Customer	Distr	ibutor	Manu	facturer
No.	DATE							CO	veť		akasho


Profile: Rectangle 50x100mm

Base: 0.547kg/m Cover: 1.258kg/m Total: 1.805kg/m

Batten thickness: 1.5mm End cap thickness: 2.0mm



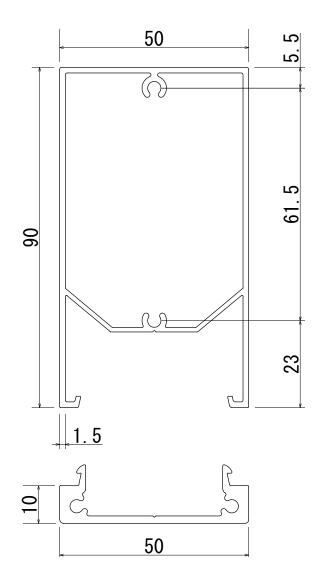


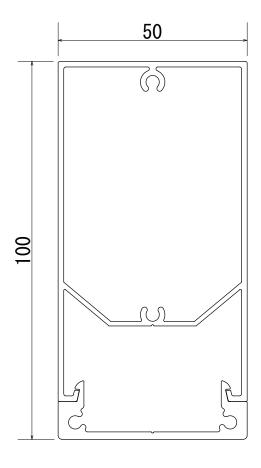



$\sqrt{3}$				Produc	t Name		Project Name	Creation Date	Page	Scale	Projection
<u> </u>		Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Eve	r Art Woo	od - Kabel	bari	Rectangle 50x100		6 of 12	1:1	♦ 母
Λ	End caps	Screw fix or apply exterior grade adhesive (Sikaflex) to secure cap to batten.	Approval	Chek	Drawing	Design	Customer	Distr	ibutor	Manu	acturer
No.	DATE		1					CO	veť	" " Ta	Kasho

Profile: Rectangle 50x100mm

Endcap detail Aluminium t=2.0

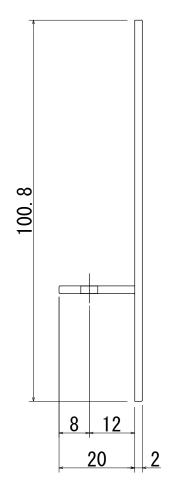

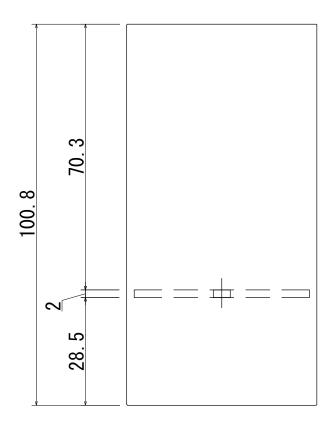

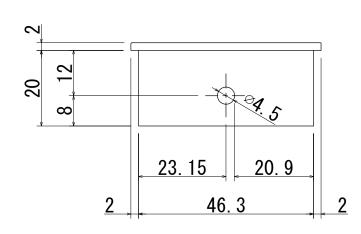


A				Product Name			Project Name	Creation Date	Page	Scale	Projection
<u> </u>		Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Eve	r Art Woo	d - Kabel	bari	Rectangle 50x100		7 of 12	1:1	♦ □
\bigcap	End caps	Screw fix or apply exterior grade adhesive (Sikaflex) to secure cap to batten.	Approval	Chek	Drawing	Design	Customer	Distr	ibutor	Manut	acturer
No.	DATE							CO	veť		ikasho

Profile: Rectangle 50x100mm

Installation detail 🛕



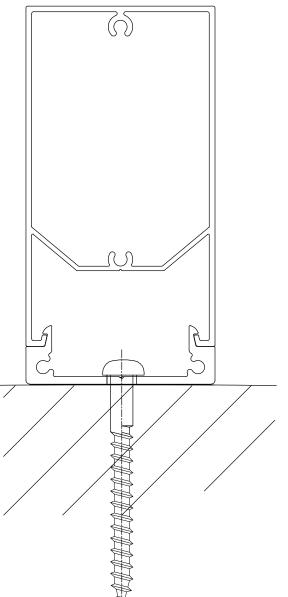

- · Aluminium can be damaged if mishandled. Never strike directly with a hammer or rubber mallet. Use a pine plank between the striking rubber mallet and the extrusion to avoid surface damage or denting.
- Cut aluminium with a drop saw using an aluminium blade.
- Always cap ends of extrusions with supplied end caps or a flashing to avoid moisture ingress.
- Plastic end caps must be securely inserted with screws supplied or sikafelx applied to the inside of the extrusion before inserting. This will prevent slippage of the extrusion.
- Metal end caps (painted) must be screwed to the extrusion.
- All end caps can only be applied to straight 90 degree cuts. They cannot be applied to angle end cuts.
- Ensure appropriate screws are used to suit the substrate you are fastening to. It is important to use stainless steel or bi-metal screws for all metal surfaces impacted when fastening (i.e. furring channels, top hats, steel frames). This will prevent galvanic reaction between the screw/substrate and aluminium extrusion.
- Fasten at maximum 1 metre spans. Please contact Covet for further information.
- Always fasten the male (base) section first. The female (top section) clips over the top. They can also slide on if necessary.


[3]			Product Name				Project Name	Creation Date	Page	Scale	Projection
<u> </u>		Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Eve	r Art Woo	d - Kabe	bari	Rectangle 50x100		8 of 12	1:1	♦ □
Λ	End caps	Screw fix or apply exterior grade adhesive (Sikaflex) to secure cap to batten.	Approval	Chek	Drawing	Design	Customer	Distri	butor	Manut	facturer
No.	DATE							CO	veť	a Ta	akasho

Profile: Rectangle 50x100mm


Aluminium Endcap Installation detail 🛕






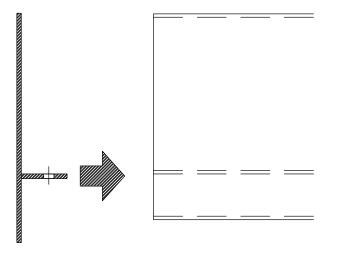




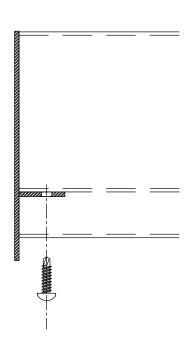




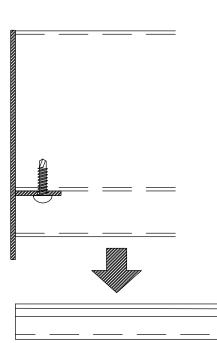

[3]				Product	t Name		Project Name	Creation Date	Page	Scale	Projection
<u> </u>		Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Eve	r Art Woo	od - Kabel	bari	Rectangle 50x100		9 of 12	1:1	ф
Λ	End caps	Screw fix or apply exterior grade adhesive (Sikaflex) to secure cap to batten.	Approval	Chek	Drawing	Design	Customer	Distr	ibutor	Manuf	facturer facturer
No.	DATE		1					CO	veť	" " Ta	каѕно

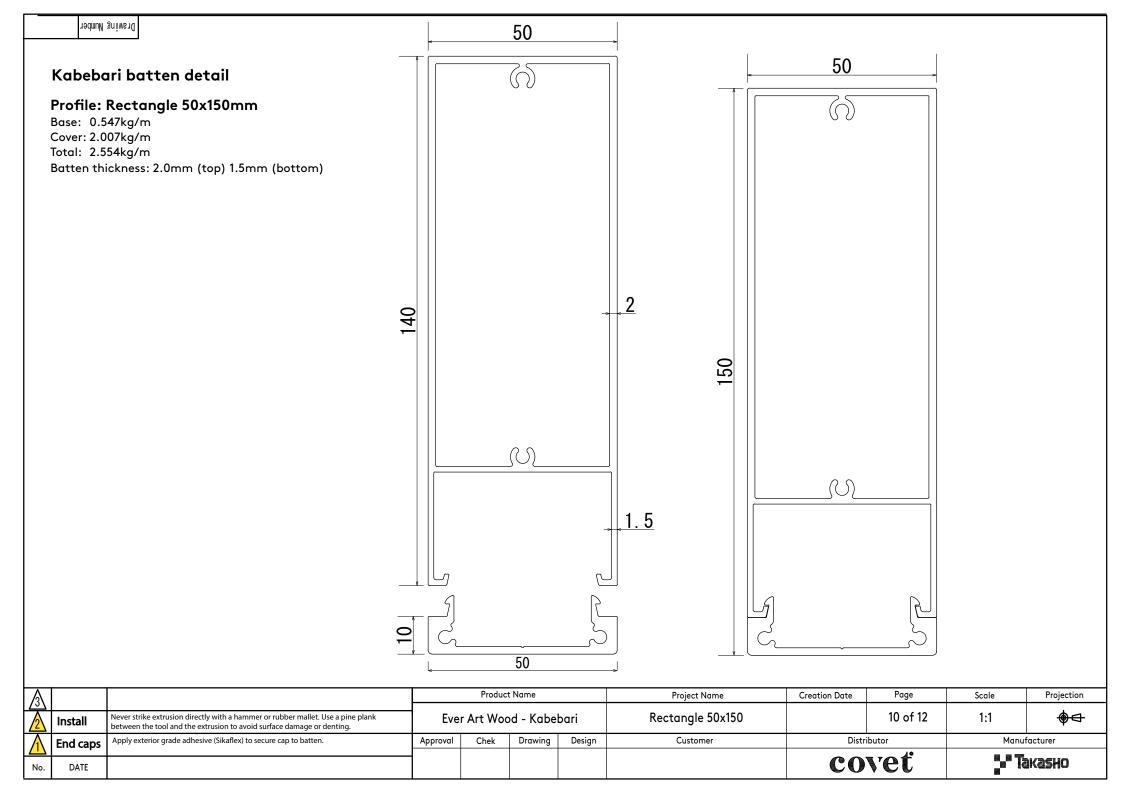

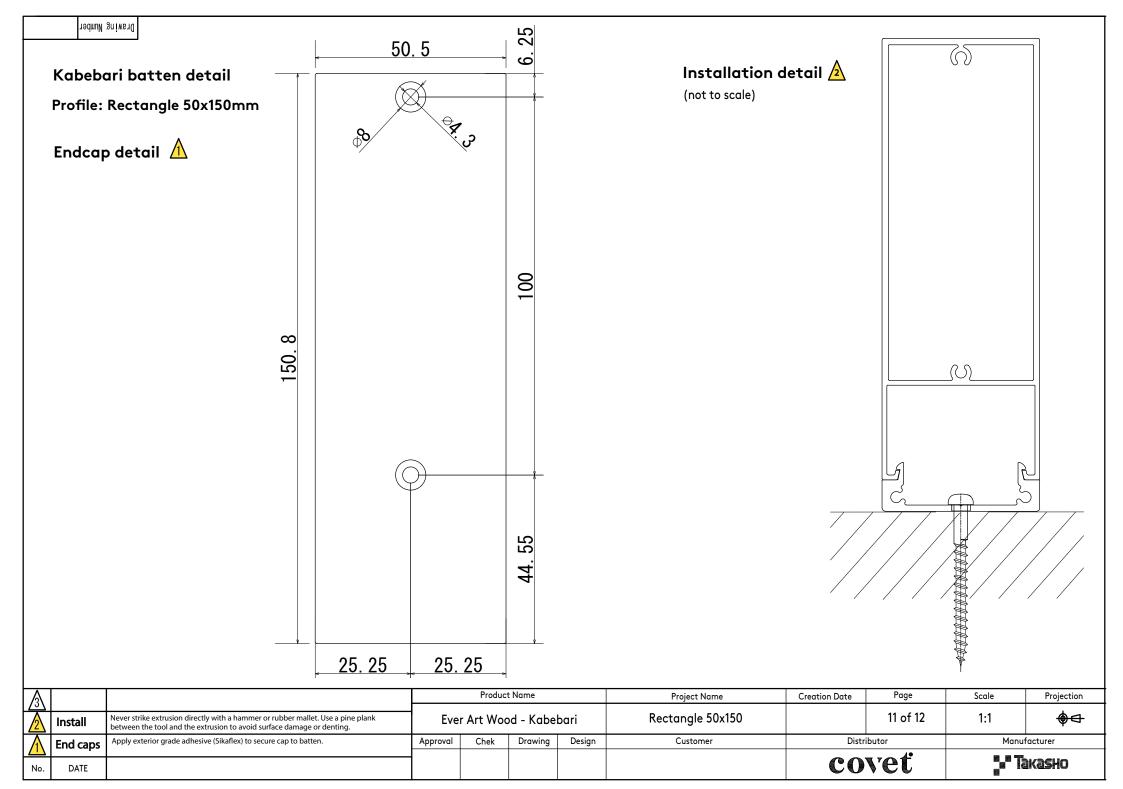

Profile: Rectangle 50x150mm

- Aluminium can be damaged if mishandled. Never strike directly with a hammer or rubber mallet. Use a pine plank between the striking rubber mallet and the extrusion to avoid surface damage or denting.
- Cut aluminium with a drop saw using an aluminium blade.
- Always cap ends of extrusions with supplied end caps or a flashing to avoid moisture ingress.
- Plastic end caps must be securely inserted with screws supplied or sikafelx applied to the inside of the extrusion before inserting. This will prevent slippage of the extrusion.
- All end caps can only be applied to straight 90 degree cuts. They cannot be applied to angle end cuts.
- Ensure appropriate screws are used to suit the substrate you are fastening to. It is important to use stainless steel or bi-metal screws for all metal surfaces impacted when fastening (i.e. furring channels, top hats, steel frames). This will prevent galvanic reaction between the screw/substrate and aluminium extrusion.
- Fasten at maximum 1 metre spans. Please contact Covet for further information.
- Always fasten the male (base) section first. The female (top section) clips over the top. They can also slide on if necessary.



A			Product Name				Project Name	Creation Date	Page	Scale	Projection
<u> </u>		Never strike extrusion directly with a hammer or rubber mallet. Use a pine plank between the tool and the extrusion to avoid surface damage or denting.	Ever Art Wood - Kabebari			bari	Rectangle 50x150		12 of 12	1:1	•
Λ	End caps	Apply exterior grade adhesive (Sikaflex) to secure cap to batten.	Approval	Chek	Drawing	Design	Customer	Distr	butor	Manut	acturer
No.	DATE		1					CO	veť	T	ikasho